


# AASCO

## PERFORMANCE

709 EAST ADELE STREET, ANAHEIM, CA 92805 PH: (704) 758-8500  
FX: (714)758-2851

Thank you for purchasing AASCO precision performance valve springs. To insure proper performance and life from your springs the following change needs to be made to the bottom spring retainer (spring seat Porsche # 901.105.463.00).

AASCO Inner Spring

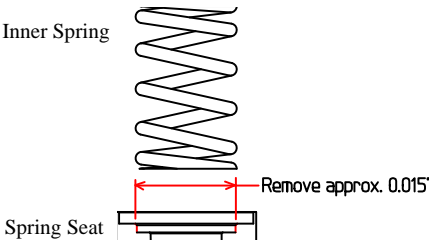

Remove approx. 0.015" (.38mm) from the seat in the area shown so the inner spring sits freely in the seat.

Installed height: 1.350" (34mm).

993 applications with 8mm valves: the valve spring retainer must be replaced with our Titanium retainers (P.N. HP10T8) and the spring seat with P.N. HPSS and machined as illustrated above.

For any technical information about this or any other product please contact Aasco Performance by phone or email us at: [aase@pacbell.net](mailto:aase@pacbell.net)